



SIEVE ANALYSIS PALMBEACH\_05\_NAVD88.GPJ FL DEP ROSS.GDT 5/10/07

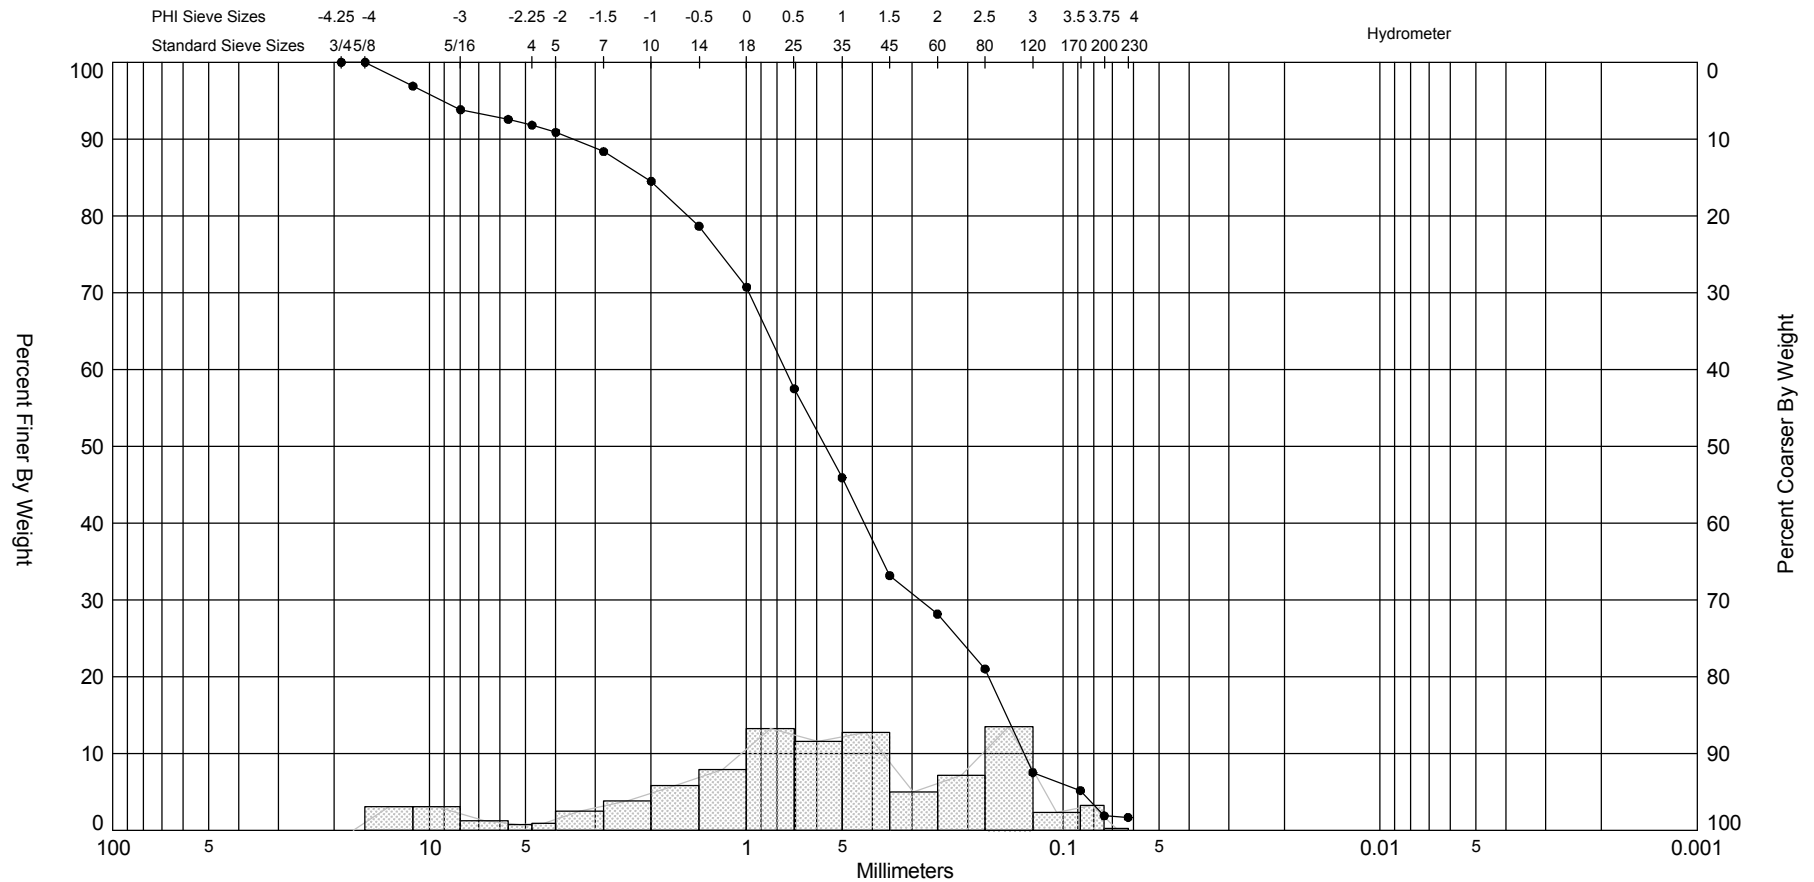

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
PBVC-05-12 #5	—●—	-33.4	SW	#200 - 1.89 #230 - 1.68		80.00	0.82	0.67	-0.59	2.94	1.8	Project Name:	Reach 8 Geotechnical Investigation
Comments:												Analysis Date:	03-17-05
Depths and elevations based on measured values												Analyzed By:	CPE
						Coastal Planning & Engineering 2481 NW Boca Raton Blvd, Boca Raton FL 33431 ph (561) 391-8102 fax (561) 391-9116						Easting (X, ft):	972,893
												Northing (Y, ft):	826,711
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88