



SIEVE ANALYSIS PALMBEACH_05_NAVD88.GPJ FL DEP ROSS.GDT 5/10/07

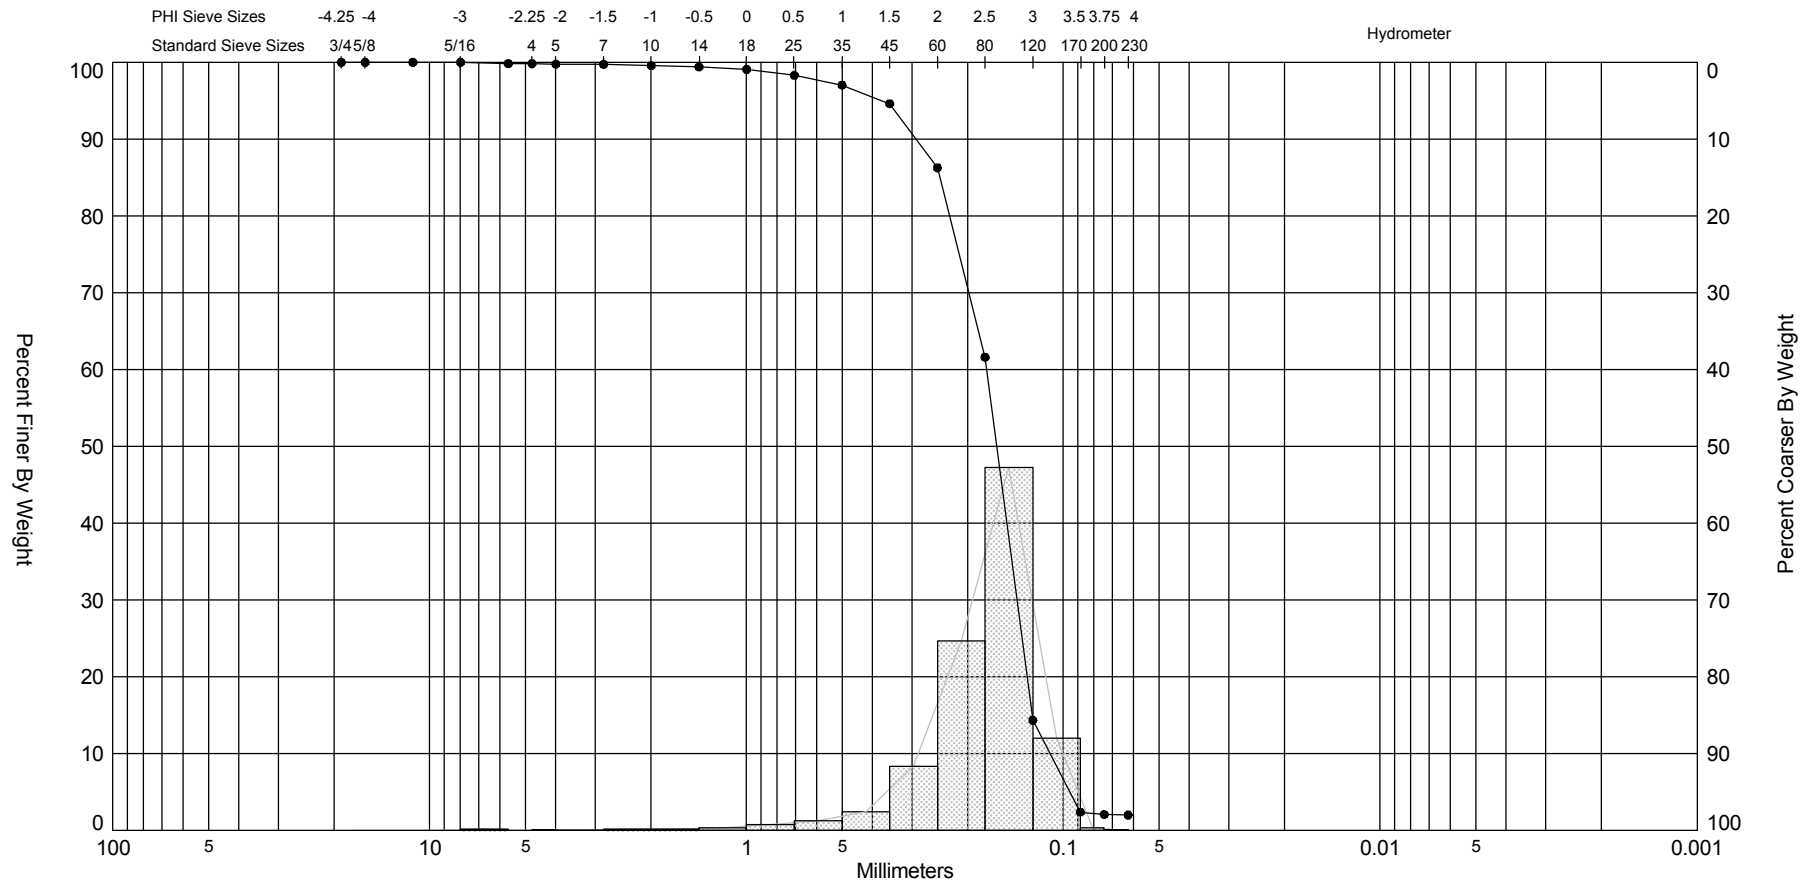

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
PBVC-05-15 #7	—●—	-40.9	SP	#200 - 2.06 #230 - 1.99			2.62	2.48	-2.64	16.13	0.65	Project Name:	Reach 8 Geotechnical Investigation
Comments:												Analysis Date:	03-18-05
Depths and elevations based on measured values												Analyzed By:	CPE
							Coastal Planning & Engineering						
							2481 NW Boca Raton Blvd, Boca Raton						
							FL 33431						
							ph (561) 391-8102						
							fax (561) 391-9116						
												Easting (X, ft):	972,769
												Northing (Y, ft):	821,109
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88