

Granularmetric Report

Depths and elevations based on measured values



Coastal Planning & Engineering
2481 NW Boca Raton Blvd, Boca Raton
FL 33431
ph (561) 391-8102
fax (561) 391-9116

Project Name: 2007 Sand Search Investigation

Sample Name: TPVC-07-19 #3

Analysis Date: 02-01-07

Analyzed By: au

Easting (ft):

972,904

Northing (ft):

832,601

Coordinate System:

Florida State Plane East

Elevation (ft):

-35.5 NAVD 88

USCS:

SW

Munsell:

Wet - 2.5Y-6/2

Dry - 2.5Y-6/2

Washed - 2.5Y-6/2

Comments:

Dry Weight (g):

80.41

Wash Weight (g):

79.11

Pan Retained (g):

0.04

Sieve Loss (%):

0.06

Fines (%):

#200 - 1.86

#230 - 1.74

Organics (%):

Carbonates (%):

50.00

Shell Hash (%):

1

Sieve Number

Sieve Size
(Phi)

Sieve Size
(Millimeters)

Grams
Retained

% Weight
Retained

Cum. Grams
Retained

C. % Weight
Retained

3/4

-4.25

19.03

0.00

0.00

0.00

0.00

5/8

-4.00

16.00

0.00

0.00

0.00

0.00

7/16

-3.50

11.31

0.00

0.00

0.00

0.00

5/16

-3.00

8.00

0.00

0.00

0.00

0.00

3.5

-2.50

5.66

0.00

0.00

0.00

0.00

4

-2.25

4.76

0.07

0.09

0.07

0.09

5

-2.00

4.00

0.09

0.11

0.16

0.20

7

-1.50

2.83

0.32

0.40

0.48

0.60

10

-1.00

2.00

0.41

0.51

0.89

1.11

14

-0.50

1.41

0.75

0.93

1.64

2.04

18

0.00

1.00

1.33

1.65

2.97

3.69

25

0.50

0.71

3.09

3.84

6.06

7.53

35

1.00

0.50

5.45

6.78

11.51

14.31

45

1.50

0.35

7.00

8.71

18.51

23.02

60

2.00

0.25

9.62

11.96

28.13

34.98

80

2.50

0.18

17.73

22.05

45.86

57.03

120

3.00

0.13

24.22

30.12

70.08

87.15

170

3.50

0.09

8.35

10.38

78.43

97.53

200

3.75

0.07

0.49

0.61

78.92

98.14

230

4.00

0.06

0.10

0.12

79.02

98.26

Phi 5

Phi 16

Phi 25

Phi 50

Phi 75

Phi 84

Phi 95

3.38

2.95

2.80

2.34

1.58

1.10

0.17

Moment

Mean Phi

Mean mm

Sorting

Skewness

Kurtosis

Statistics

2.07

0.24


0.98

-1.24


4.7

GRANULARMETRIC REPORT TOPB_VC_07.GPJ FL DEP ROSS.GDT 5/10/07

SIEVE ANALYSIS TOPB_VC_07.GPJ FL DEP ROSS.GDT 5/10/07

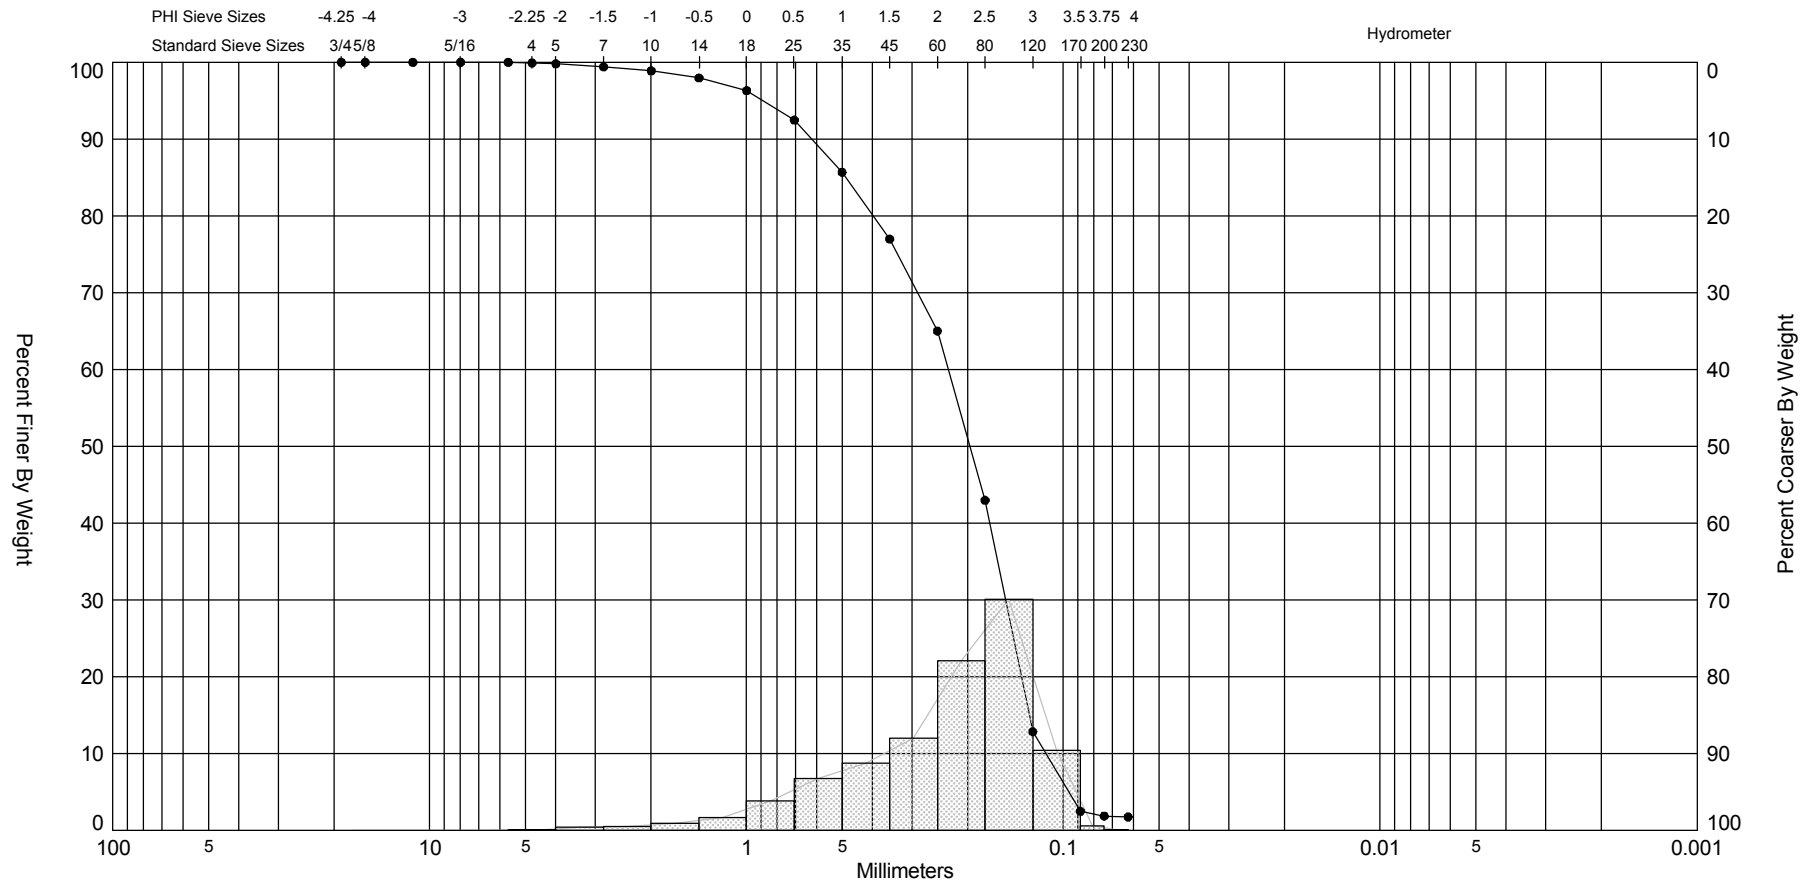

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
TPVC-07-19 #3	—●—	-35.5	SW	#200 - 1.86 #230 - 1.74		50.00	2.34	2.07	-1.24	4.7	0.98	Project Name:	2007 Sand Search Investigation
Comments:												Analysis Date:	02-01-07
Depths and elevations based on measured values												Analyzed By:	au
						Coastal Planning & Engineering 2481 NW Boca Raton Blvd, Boca Raton FL 33431 ph (561) 391-8102 fax (561) 391-9116						Easting (X, ft):	972,904
												Northing (Y, ft):	832,601
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88