



SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

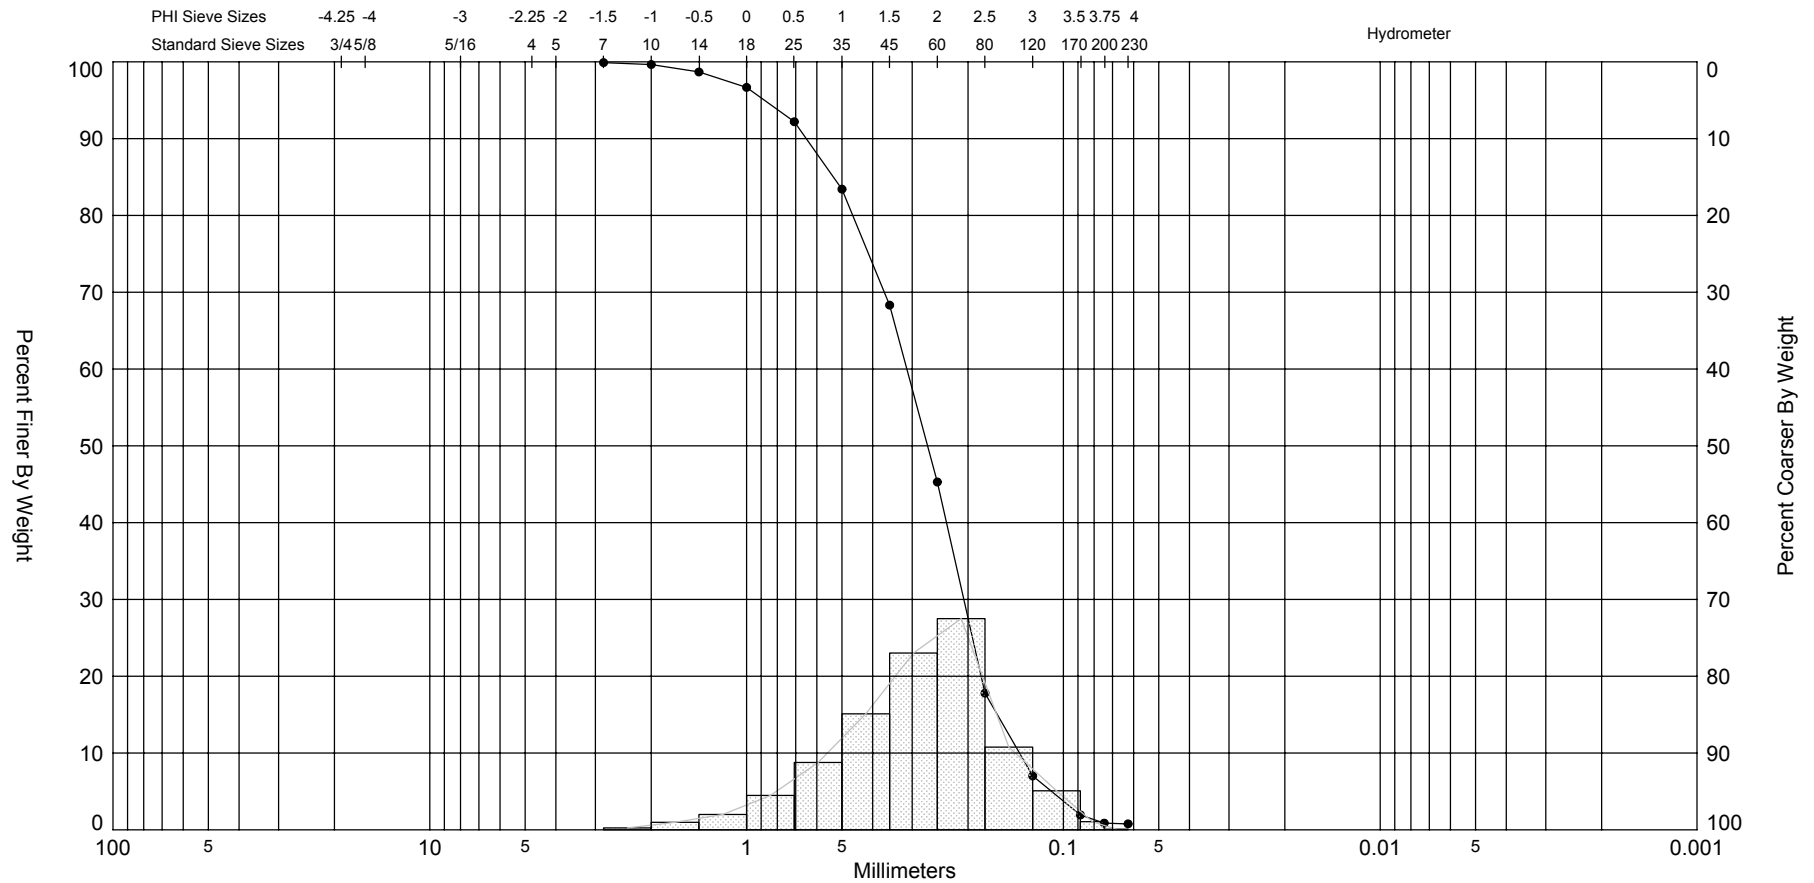

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-58 #1.0	—●—	-68.0	SP	#200 - 0.87 #230 - 0.78		51.52	1.9	1.79	-0.53	3.44	0.85	Project Name:	Singer Island 2005
Comments:												Analysis Date:	08-23-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,424
												Northing (Y, ft):	909,266
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

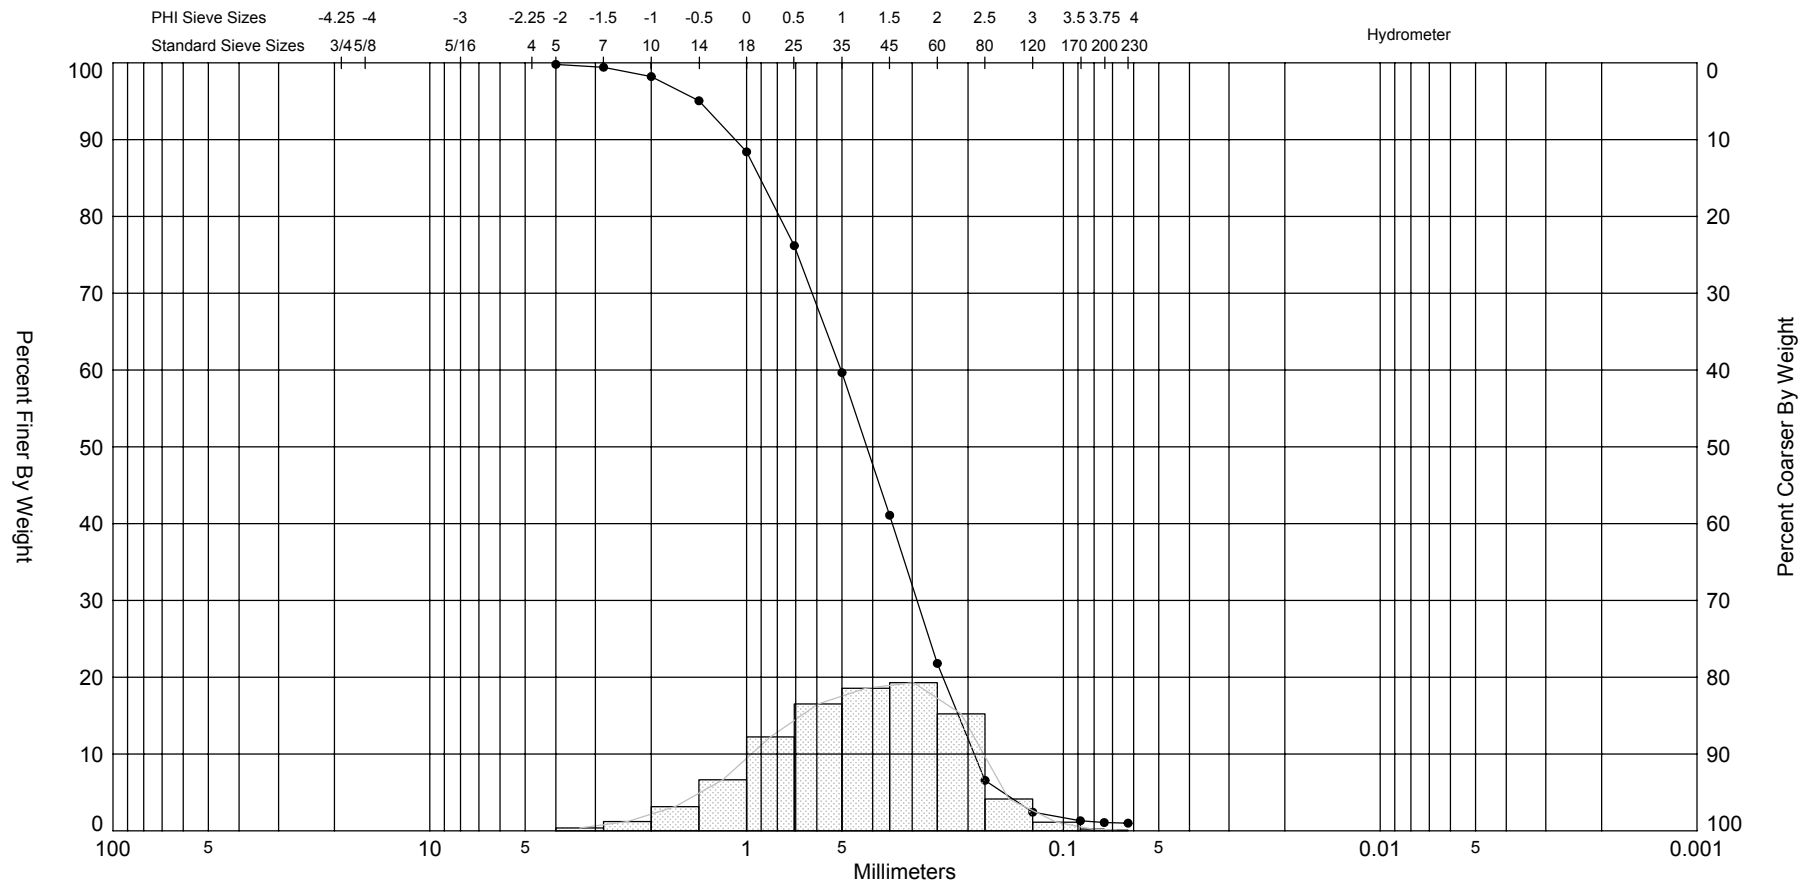

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-58 #3.0	—●—	-70.0	SW	#200 - 1.08 #230 - 1.00		75.23	1.26	1.17	-0.29	2.82	0.95	Project Name:	Singer Island 2005
Comments:												Analysis Date:	08-23-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,424
												Northing (Y, ft):	909,266
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

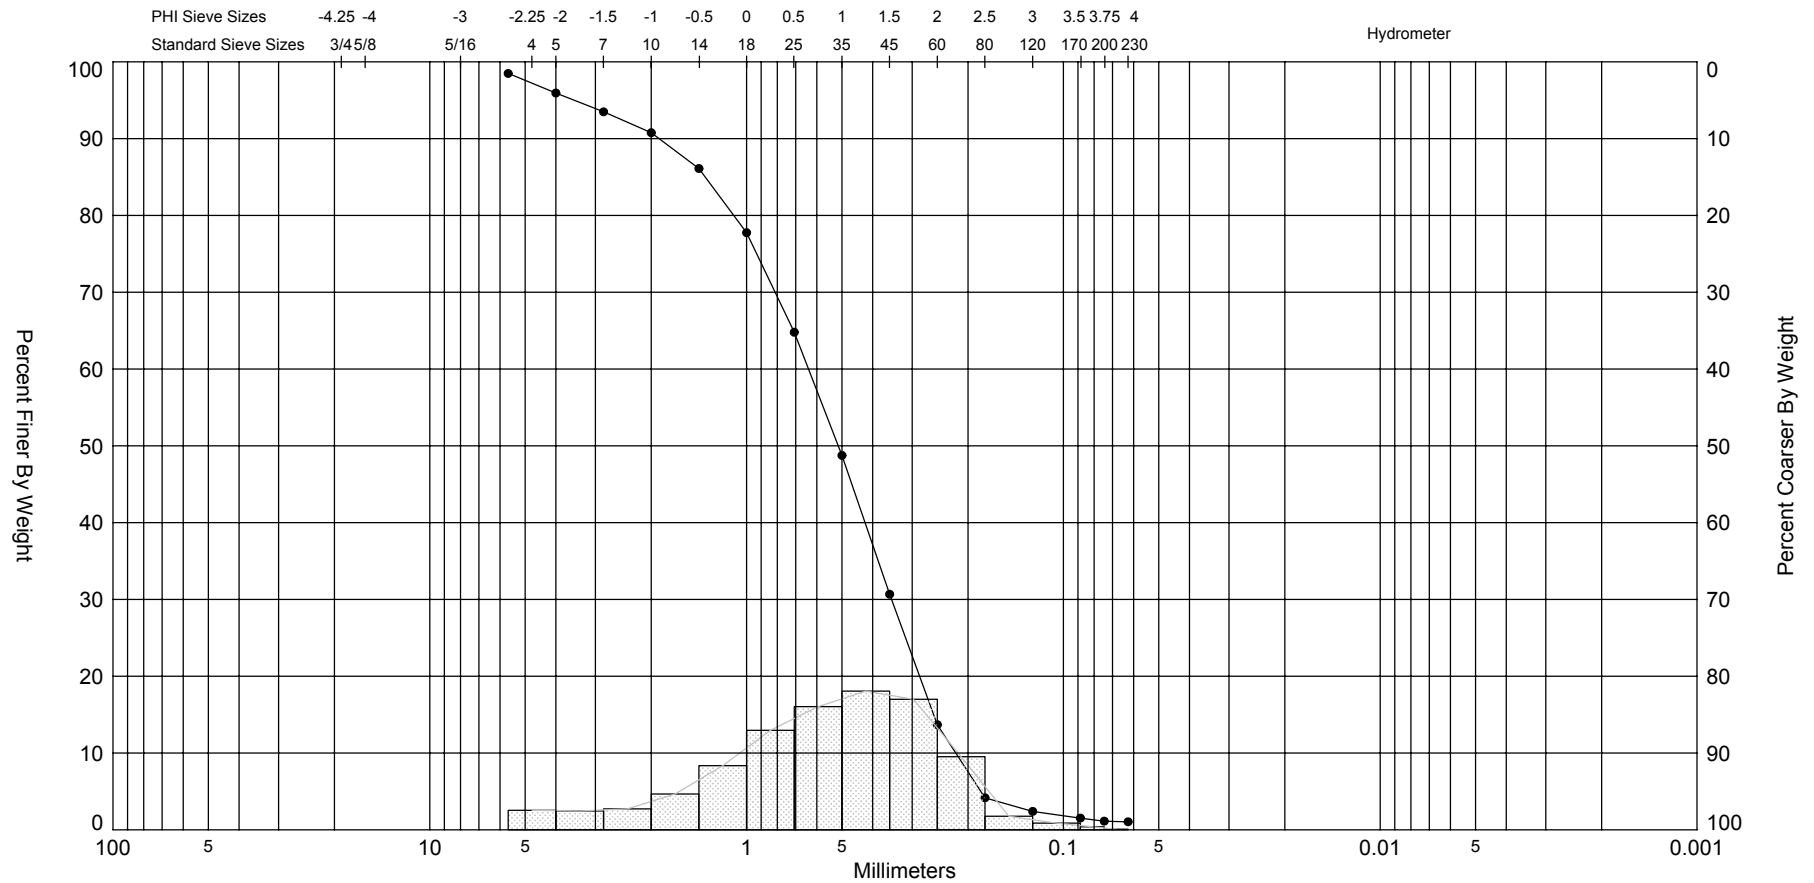

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	


Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-58 #6.0	—●—	-73.0	SW	#200 - 1.13 #230 - 1.05		82.00	0.96	0.76	-0.45	3.16	1.15	Project Name:	Singer Island 2005
Comments:												Analysis Date:	08-23-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications						Easting (X, ft):	974,424
						5575 Willoughby Drive						Northing (Y, ft):	909,266
						Melbourne, FL 32934						Horizontal System:	NAD 1983
						ph 321 254-2708 fax 321 254-2708						Vertical System:	NGVD 29

SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

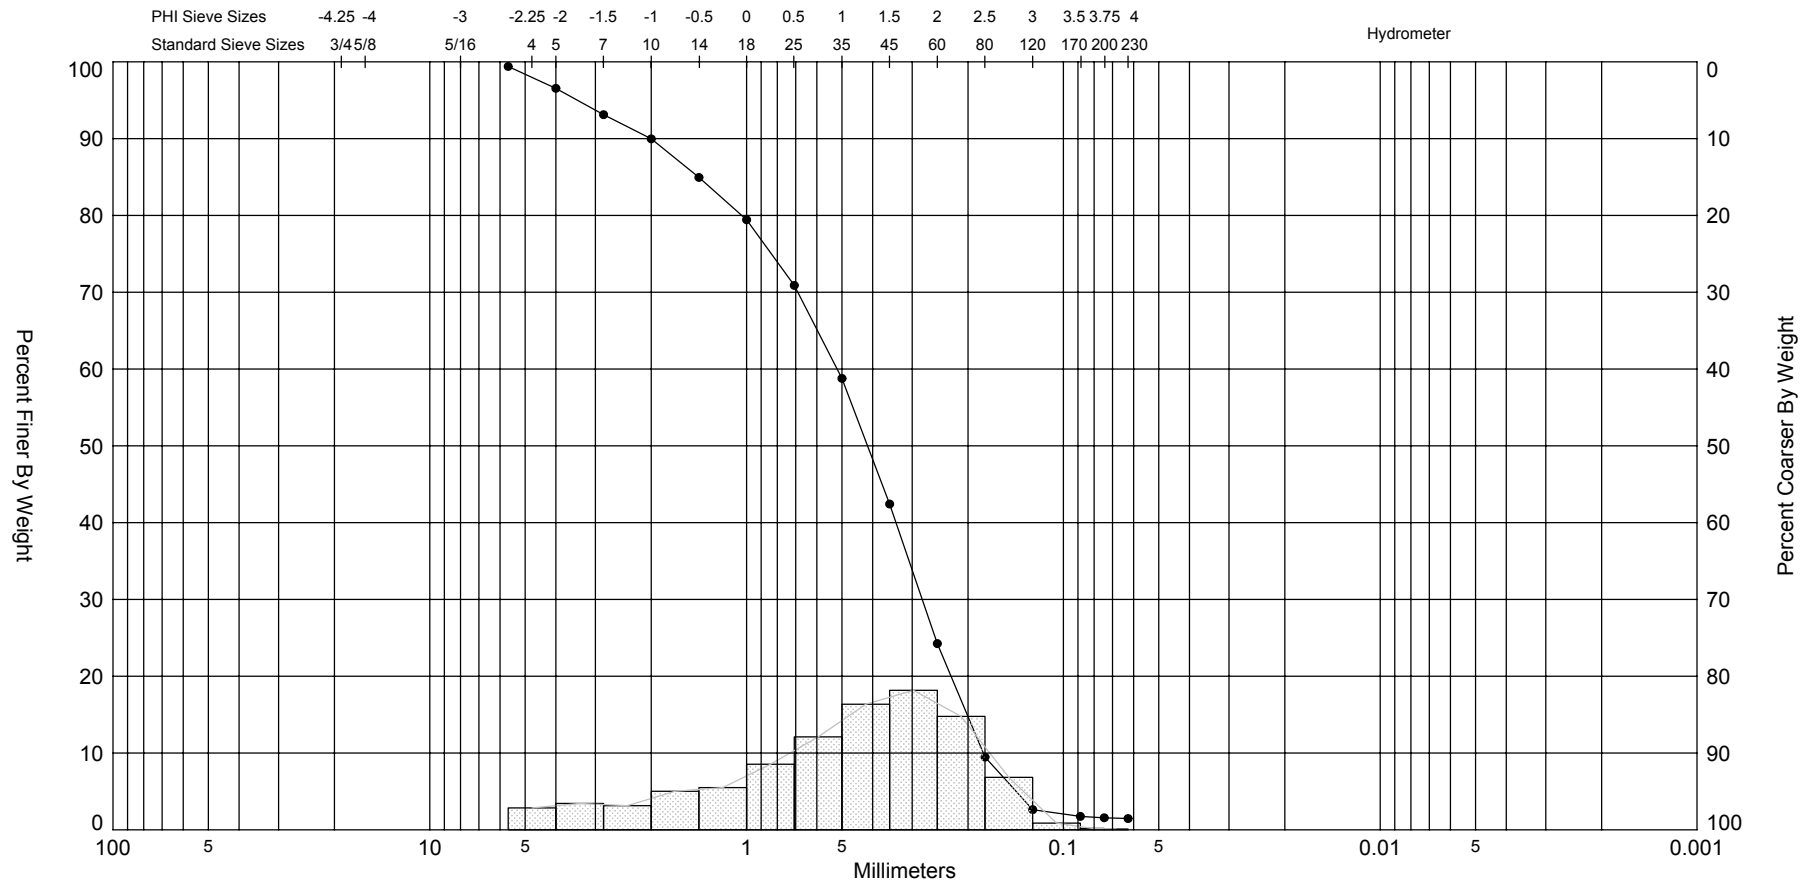

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-58 #9.0	—●—	-76.0	SW	#200 - 1.57 #230 - 1.47		86.66	1.27	0.98	-0.7	2.91	1.29	Project Name:	Singer Island 2005
Comments:												Analysis Date:	08-23-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,424
												Northing (Y, ft):	909,266
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-58 #Comp		-77.0	SW	#200 - 1.30 #230 - 1.19		73.38	1.42	1.29	-0.31	2.99	1.03	Project Name:	Singer Island 2005
Comments:												Analysis Date:	08-23-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,424
												Northing (Y, ft):	909,266
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29